

Power Monitoring Sensor (PMS)



The AKCP Power Monitor Sensor gives vital information and allows you to remotely monitor power eliminating the need for manual power audits as well as providing immediate alerts to potential problems.

It has been integrated into the base unit web interface with its own "Power Management" menu, allowing up to six three phase and fourteen single phase Power Monitor Sensors to be set up on a single securityProbe or SPX+. More PMS can be connected to a single base unit depending on what readings are required.

Data collected over time using the Power Monitor sensor can also be viewed using the built in graphing tool. Combining this durable Power Monitor Sensor with the SPX+ or securityProbe base unit creates an IP-enabled power monitoring capable of monitoring:


- Phase Line Voltages
- Current
- Power Factor
- Active Energy
- Active Power

Power Monitoring Sensor

www.akcp.com 210



ILPM - Technical Diagram

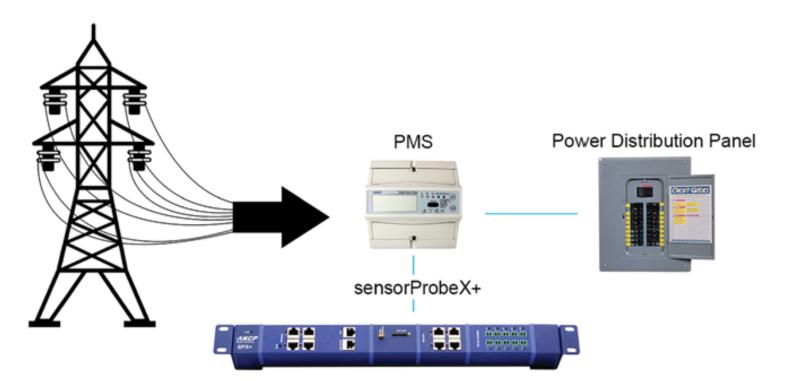

Power Monitoring Sensor

www.akcp.com



PMS - Technical Specification

Voltage (V)			
Rated Voltage (Un)	230V AC	230/400V AC (3")	230/400V AC (3")
Operational Voltage Range	0.7~1.3Un	161/279-300/520V AC (3")	161/279-300/520V AC (3")
Current (A)			
Basic Current (b)	10A	10A	1.5A
Maximum Current	100A	100A	6A
Operational Current Range	0.4% ib-lmax	0.4% lb- lmax	0.4% lb- lmax
Over Current Withstand	30lmax	30lmax for 0.1s	30lmax for 0.01s
Internal Power Consumption	≤2W / 10VA	≤2W/10VA per phase	≤2W/10VA per phase
Frequency			
Operational Frequency Range	5-60Hz ±10%	50Hz ±10%	50Hz ±10%
Operating Environment			
Operating humidity	<75%	<75%	<75%
Operating temperature	-10°C - +50°C	-10°C - +50°C	-10°C - +50°C
International standard	IEC 62053-21	IEC 62053-21	IEC 62053-21
Accuracy Class			
Voltage	±0.5%	±0.5%	±0.5%
Amps	±0.5%	±0.5%	±0.5%
Frequency (Hz)	±0.2%	±0.2%	±0.2%
Dimensions			
Height	100 mm	130mm	130mm
Width	76 mm	126mm	126mm
Depth	65.5 mm	65mm	65mm
Max Diameter Cable	11.5 mm		
Weight	0.35 Kg	0.7 Kg (net)	0.7 Kg (net)


Power Monitoring Sensor


www.akcp.com




PMS - Technical Drawing

Single Phase

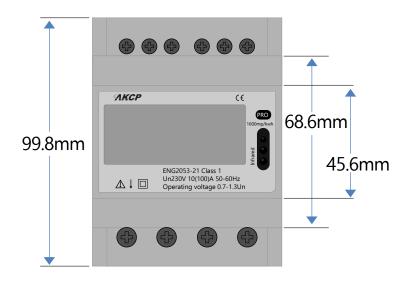

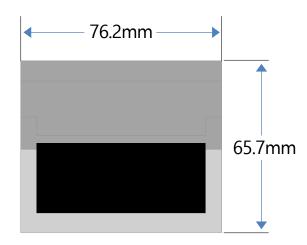

Three Phase

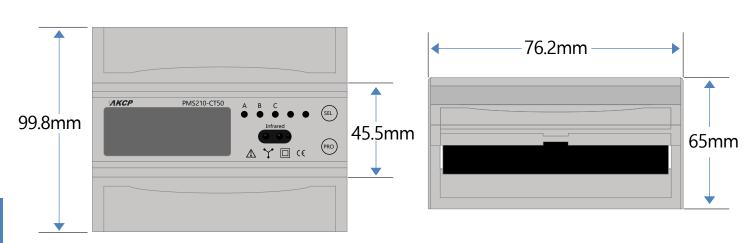

Power Monitoring Sensor

www.akcp.com _____ 213